



Pre-shipment Inspection (PSI)

BASIC INSPECTION INFORMATION

Product:	Paw Patrol shower gel 3 in1 400ml- Chase & Marshall & Skye 3D	
Brand:	Paw Patrol	
Inspection location:	XXXXXX	
Inspection date:	Mar.15.2025	
Supplier:	XXXXXX	
Factory:	XXXXXX	
Inspector :	Colin	
Order quantity:	31878 PCS (3542 ctns)	
Qty ready for inspection (%):	31878 PCS (100% finished, and 100% packed), (See attached qty breakdown)	
Reference sample available:	No	

INSPECTION RESULT JUDGMENT

OVERALL RESULT: Accepted !

CRITERIA	RESULTS		REMARKS		
1. Quantity	Pass		N/A		
2. Product and packing check	Pass		N/A		
3. On-site tests & special requirements	Pass		N/A		
4. Workmanship AQL:	Allowed quality level (AQL)		CRI	MAJ	MIN
		Found	0	0	12
		Max	0	14	21
		Checked	500	500	500

REMARKS

N/A



INSPECTION STANDARDS							
Inspection type			Final Random Inspection (FRI)- <u>1st inspection</u>				
Sampling standard			ANSI/ASQ Z1.4-2008 (MIL-STD-105E)				
Sampling Plan (Single)			G-II (<u>normal inspection</u>)				
AQL for Critical/ Major/ Minor			0 /1.5/4.0				
Sampling size for Cri/Maj/Min			<u>500 /500 /500</u>				
No. of cartons selected and inspected			No carton number printed on outer carton				
1. Quantity		Result : Passed					
Approximate 80%of the total order quantity must be finished and packed		31878 pcs(100.0 %) units finished and 31878pcs (100.0%)packed into outer carton.					
		Item#	Oder require d	Actual finished	Gift box packed	Outer carton packed	S/S
		Chase	5346	5346	5346	5346	84
		Marshall	5346	5346	5346	5346	84
		Skye	21186	21186	21186	21186	332
		Total	31878	31878	31878	31878	500

2.Product and packing check (photo)	Result : Passed
	
Finished products in warehouse	Finished products in warehouse




Outer carton view



Outer carton view- front & back



Outer carton view-sides

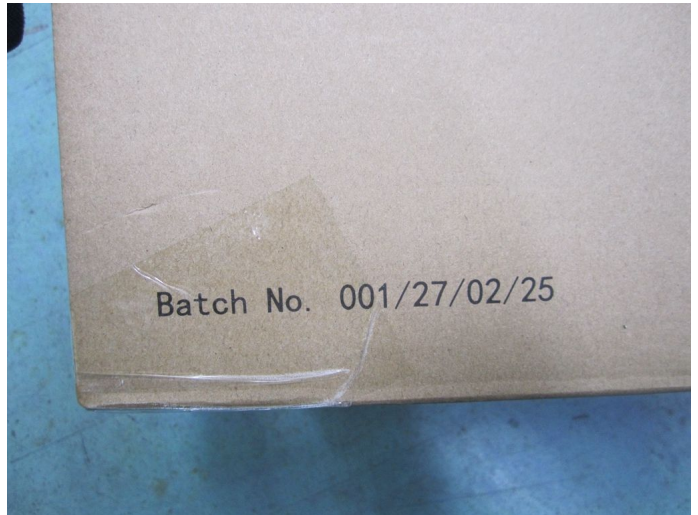


Batch number on outer carton



Product number on outer carton




Product number on outer carton

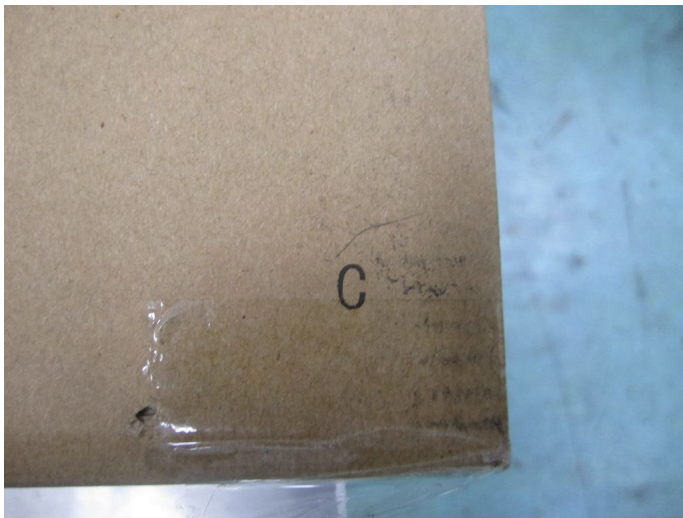

Product number on outer carton



Outer carton packing

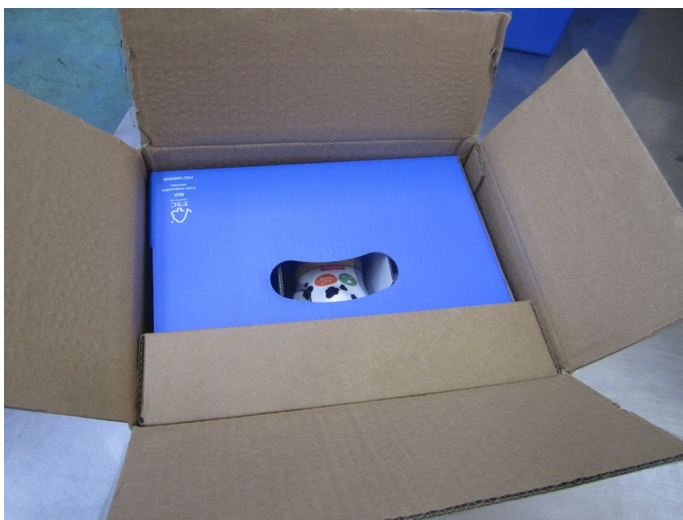

Outer carton packing



PDQ view



PDQ view



PDQ view



PDQ view



PDQ packing



PDQ packing




PDQ packing



Marking on PDQ




PDQ view

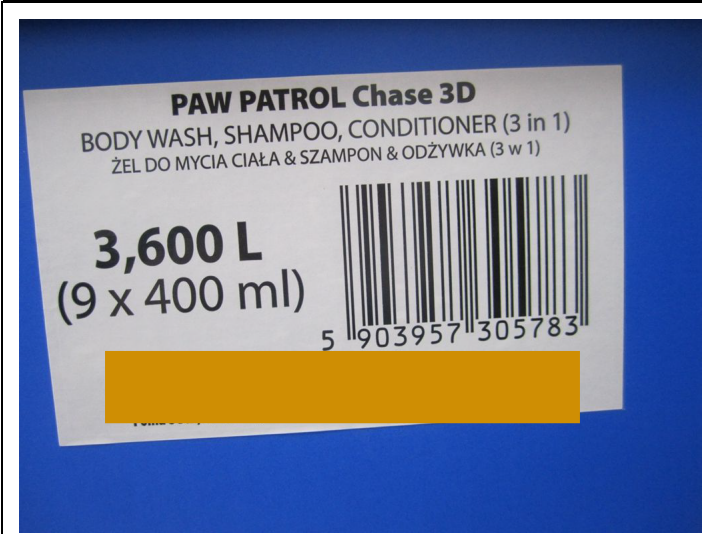

Barcode on PDQ




Scanning test

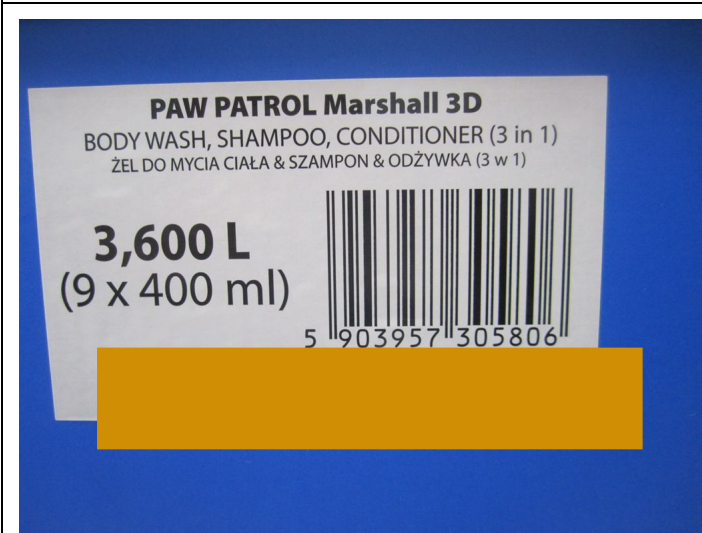


Barcode on PDQ



Scanning test

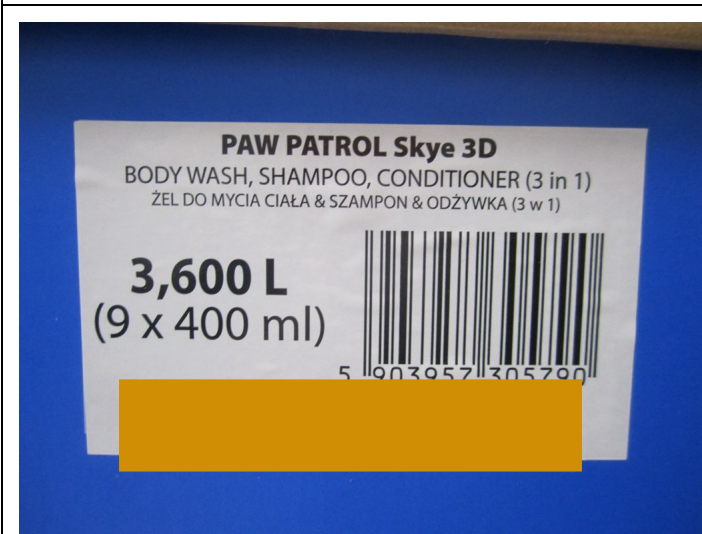

Barcode on PDQ

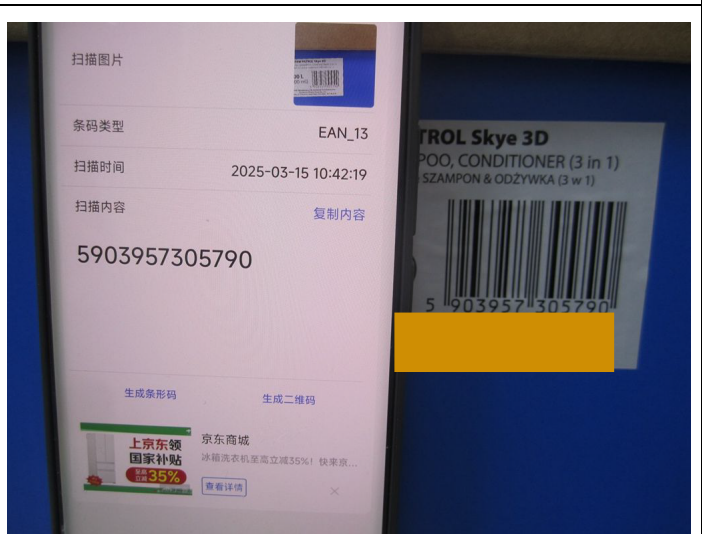

Scanning test



Product view



Product view




Product view



Product view



Product view

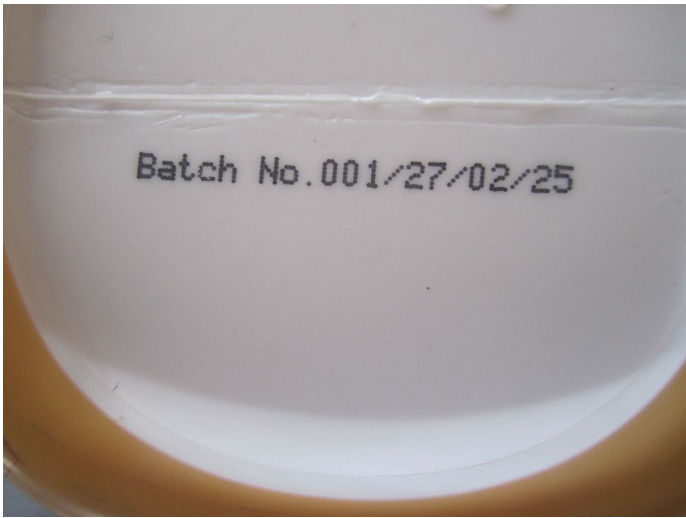

Batch number



Bottle material




3 in 1 sticker



3 in 1 sticker



3 in 1 sticker

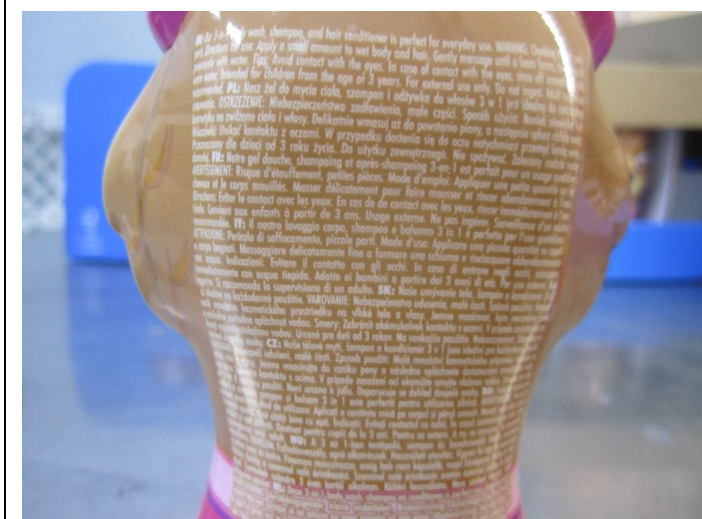


Marking on bottle surface



Marking on bottle surface




Scanning test

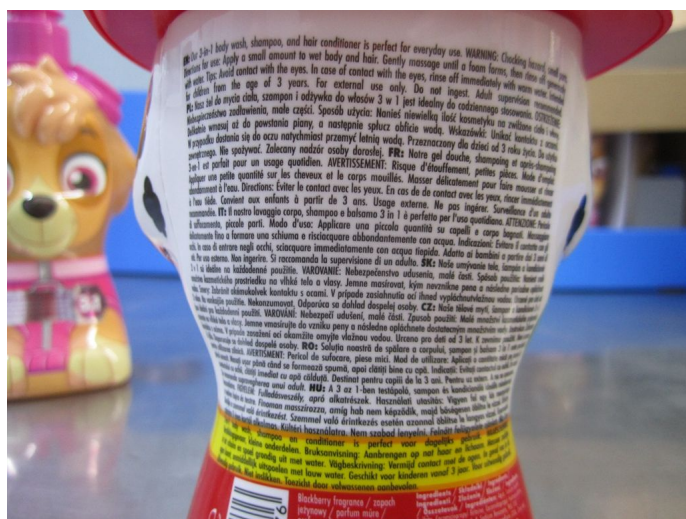


Marking on bottle surface



Marking on bottle surface

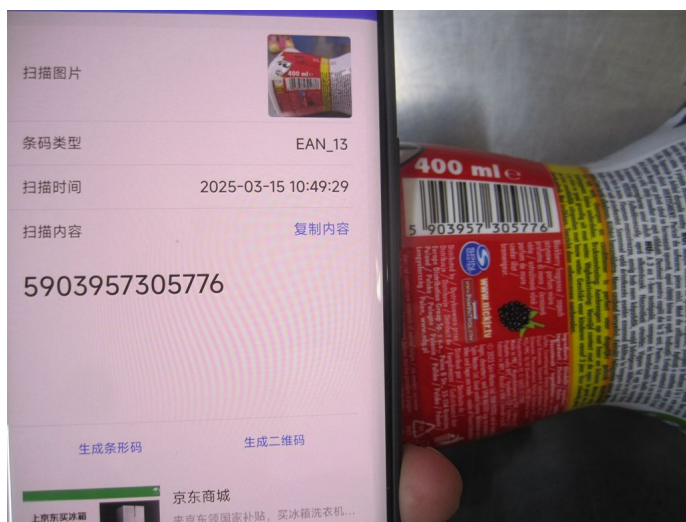


Scanning test

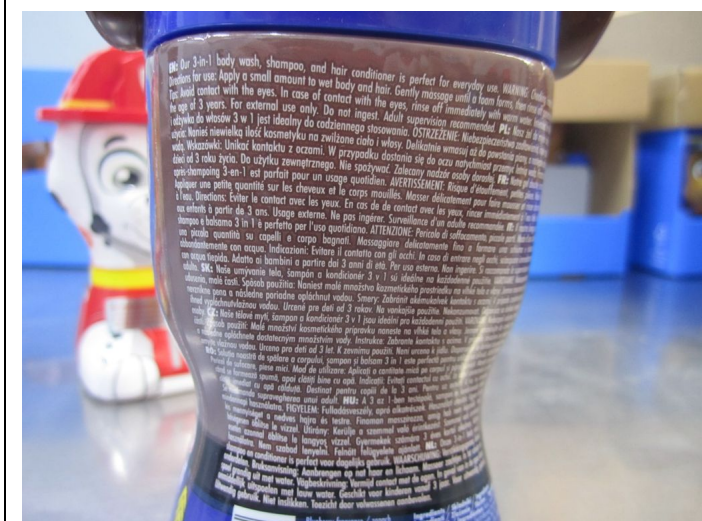

Marking on bottle surface



Marking on bottle surface

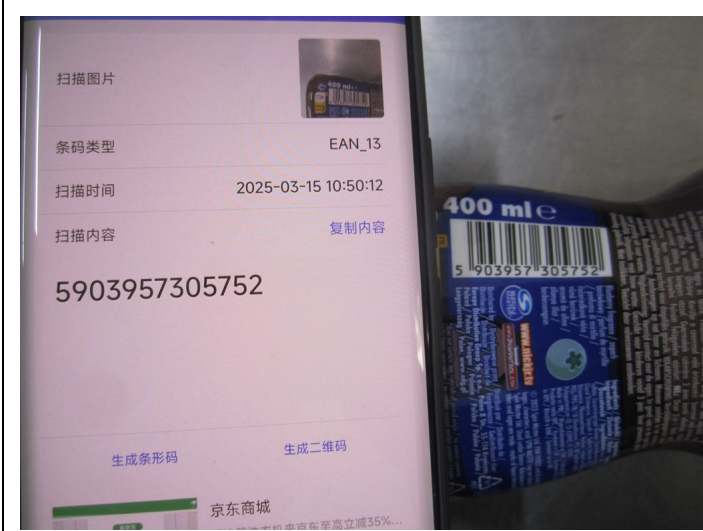

Scanning test



Product and sample comparing



Product and sample comparing



Product and sample comparing




Product and sample comparing



Product and sample comparing



Product and sample comparing

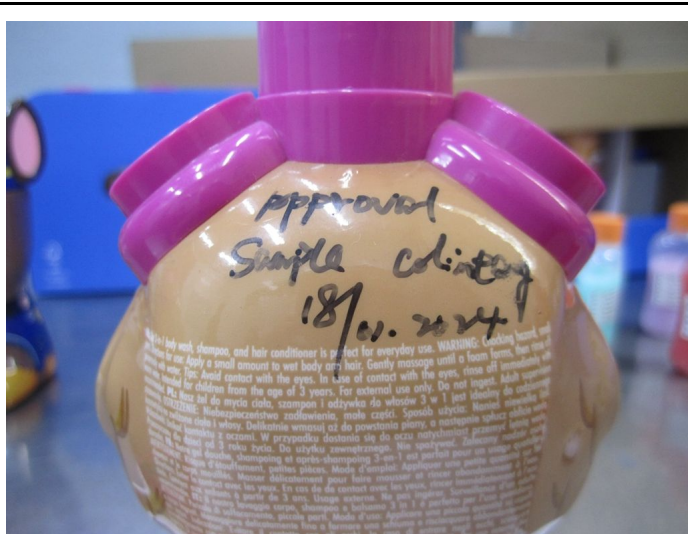

Sample signature date



Product weight check



Product weight check




Product weight check




Product weight check

	
Product weight check	Product weight check
	
Outer carton gross weight check	Outer carton length check
	
Outer carton width check	Outer carton height check

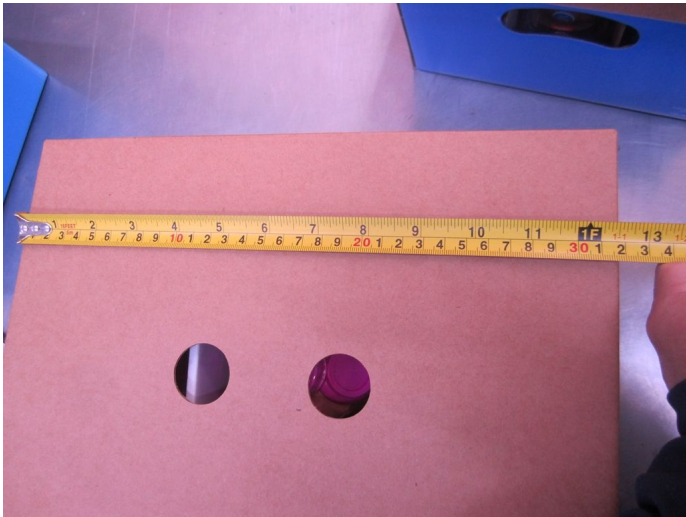	
PDQ weight check	PDQ weight check
	
PDQ weight check	PDQ size check
	
PDQ weight check	PDQ weight check

3. ON-SITE TESTS & SPECIAL REQUIREMENTS	Result : Pass
---	---------------

Test Requirements	Comments from Inspector (Actual finding/photo)	Result
Universal test requirements		
1.Normal function check.(G-II: <u>500</u> pcs) (Check each function of the bottle lid, and all the function should be no problem)	 	Pass
2.Bar code scanning test (S-3: <u>32</u> pcs))		Pass

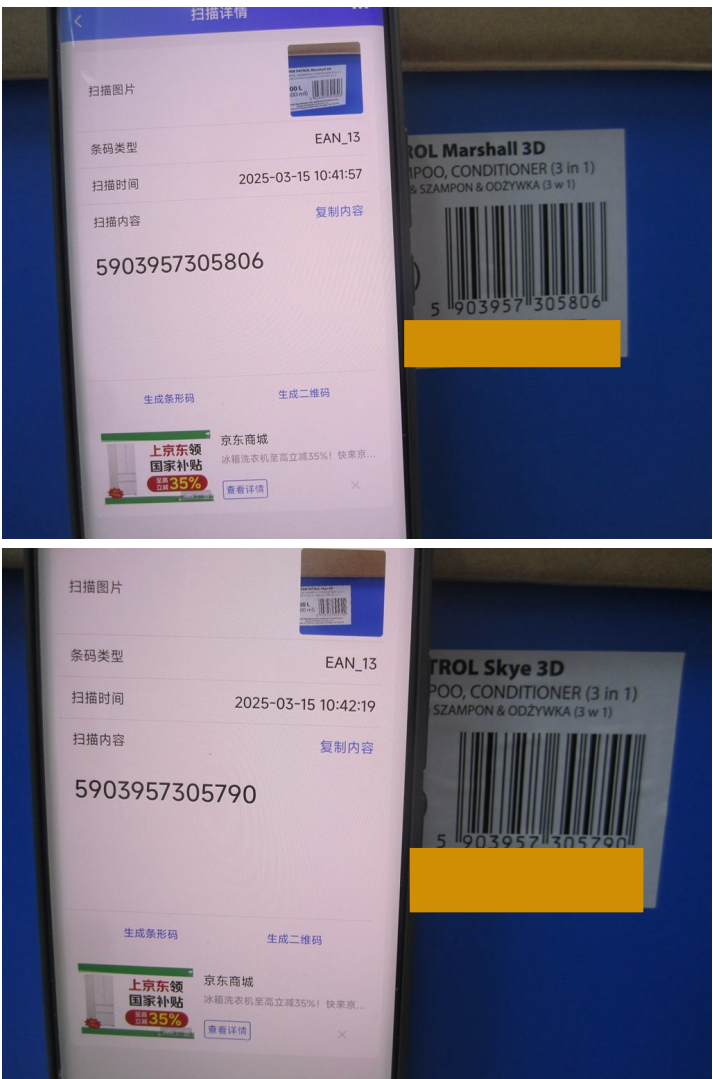		
3. 3M tape adhesive test (S-3_0_pcs) (Use 3M tape to do this test)	N/A	N/A
4. Internal structure/Major Components check (1-3 pcs per item)	N/A	N/A



5. Carton dimension and weight check (3 ctns per item) (The tolerance should be within +/- 5% of the carton size and weight which printed on carton)	Actual pallet size and weight measurement as below: <table border="1"> <thead> <tr> <th>Item#</th><th>Printed on master carton/Spec</th><th>Actual measuring</th></tr> </thead> <tbody> <tr> <td>Nil</td><td>26.4x20.0x33.3cm/ Nil</td><td>27.0x20.0x33.5cm/ 5.27 /5.16/5.14kgs</td></tr> </tbody> </table>	Item#	Printed on master carton/Spec	Actual measuring	Nil	26.4x20.0x33.3cm/ Nil	27.0x20.0x33.5cm/ 5.27 /5.16/5.14kgs	Pass
Item#	Printed on master carton/Spec	Actual measuring						
Nil	26.4x20.0x33.3cm/ Nil	27.0x20.0x33.5cm/ 5.27 /5.16/5.14kgs						
6. Carton drop test (1 ctn per item) (ISTA-1A, 1 corner, 3 edge and 6 face of master carton, height : ____cm) , no master carton and product damaged.	The factory refused to do carton drop test during inspection due to the PDQ packing	N/A						
Special test requirements (Depend on different product)								



7. Transportation test for outer carton (1-2 ctns per item)

Use the factory's transportation test machine to do this test, and check if the product or package has any problem after test



Pass



8. Liquid leakage test (3 pcs per item)

Turn down the bottles for 2 hours , and then check if the Liquid is leaking or not



Pass



9. Bottle and liquid volume check (3 pcs per item)

Use the factory's volume test cup to check if the bottle volume is 400 ml, and then weight the liquid weight)



Pass





10. Liquid bubble effect check (3 pcs per item)

Mixing the shampoo with water, and then check the bubble effect



Pass



11. Smell test (3 pcs per item)
Compare the liquid sample, and check
scent of each item)



Pass



4. DEFECTIVES LIST

Defect description	CRI	MAJ	MIN	Defective Picture
Item# Paw Patrol shower gel 3in1 400ml- Chase & Marshall & Skye 3D				



Scratch mark on product surface - 刮伤	0	0	6	  
--------------------------------------	---	---	---	---





Poor printing on the shrink film - 热缩膜印刷不良	0	0	5	
---	---	---	---	---



Foreign object inside the shrink film -热缩膜内有异物

0

0

1

Item# Paw Patrol shower gel 3in1 400ml- Chase & Marshall & Skye 3D				
Sample size	Maximum Allowed	Total Defects	Result	Notes



CRI : 500	0	0	Pass	N/A
MAJ :500	14	0	Pass	N/A
MIN :500	21	12	Pass	N/A

Remark: If no found the relevant AQL for the item reference , pls refer the AQL of most proximate sample size. for example, no AQL for sample size 150 pcs, pls refer the AQL of most proximate sample size of 125 pcs. If the AQL failed, the overall inspection result should be rejected, and pls make a remark like "Rejected due to AQL failed for item XXXX" on the fist page of report

End of the Report