



Pre-shipment Inspection (PSI)

BASIC INSPECTION INFORMATION		
Product:	Paw patrol paw bath bombs 5 x 20 g black berry	
Brand:	N/A	
Inspection location:	Xia men city, Fujian province, China	
Inspection date:	Mar.16.2026	
Supplier:	XXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXX	
Factory:	XXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXX	
Inspector :	Colin	
Order quantity:	24300 PCS (675 ctns)	
Qty ready for inspection (%):	24300PCS (100% finished, and 97.8 % packed), (See attached qty breakdown)	
Reference sample available:	No	

INSPECTION RESULT JUDGMENT					
OVERALL RESULT: Pending, see remark 3,4 & test special requirements 6,7,8					
CRITERIA	RESULTS		REMARKS		
1. Quantity	Pass		N/A		
2. Product and packing check	Pending		See remark 3,4		
3. On-site tests & special requirements	Pending		special requirements 5,6,7,8		
4. Workmanship AQL:	Allowed quality level (AQL)		CRI	MAJ	MIN
		Found	0	0	7
		Max	0	14	21
		Checked	315	315	315

REMARKS
1.For all items, there is around 1.5 cm empty space was found in the outer carton packing,it's same as last shipment.


2.No customer's approval samples were provided during inspeciton, we could only refer the samples of last shipment.



3. For item#9250 Paw patrol claw Bath bomb, actually found that the unit packs was very disorder when moving the outer carton, suggest to add the carboards to prevent the unit packs moving.



4. The actual measured outer carton gross weight is 5.2 kgs, instead of 4.66 kgs printed on outer carton, exceed +/-5%.

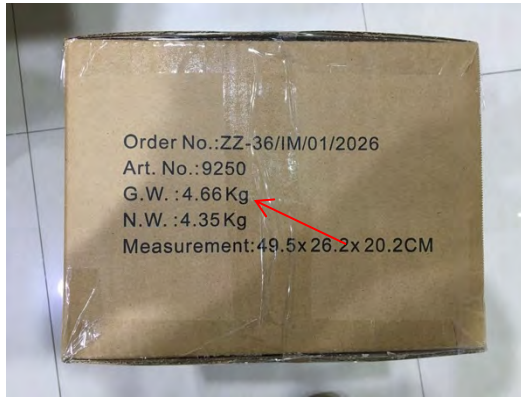

INSPECTION STANDARDS

Inspection type	Final Random Inspection (FRI)- <u>1st</u> inspection
Sampling standard	ANSI/ASQ Z1.4-2008 (MIL-STD-105E)
Sampling Plan (Single)	G-II (normal inspection)
AQL for Critical/ Major/ Minor	0 /2.5/4.0
Sampling size for Cri/Maj/Min	<u>315</u> / <u>315</u> / <u>315</u>
No. of cartons selected and inspected	No carton number printed on outer carton



1. Quantity	Result : Pass					
Approximate 80%of the total order quantity must be finished and packed	24300 pcs(100%) units finished and 23760pcs (97.8%)packed into outer carton.					
	Item#	Oder required	Actual finished	Gift box packed	Outer carton packed	S/S
	Individual packing					
	9250	24300	24300	24300	23760	315
	Total	24300	24300	24300	23760	315

2.Product and packing check (photo)	Result : Pending, see remark 3
-------------------------------------	--------------------------------

Item#9250 (Paw patrol bath bombs 5x20g black berry)



Finished products in ware house

Outer carton view



Outer carton view-front & back

Scanning test



Scanning test



Shipping mark -sides



Outer carton packing



PDQ view



PDQ view



PDQ view



PDQ view



PDQ view



PDQ view



Barcode sticker on PDQ



Scanning test



PDQ view



PDQ packing



Unit pack view



Unit pack view



Unit pack view



Unit pack view



Unit pack view




Unit pack view



Unit pack view



Unit pack view

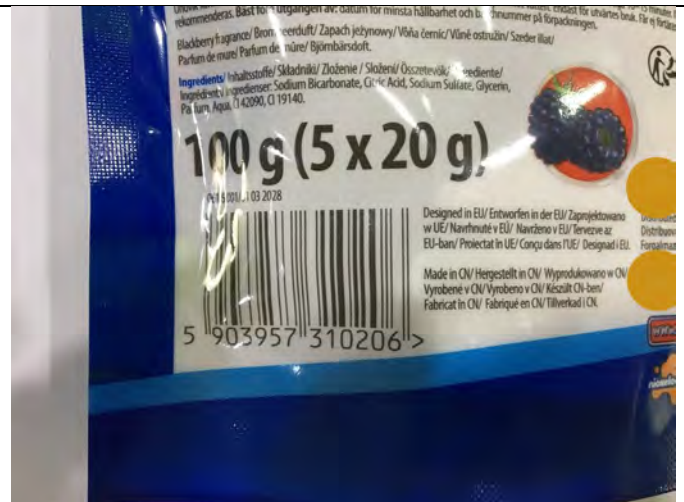

Barcode on unit pack



Barcode scanning test



Products view with shrink film



Products view with shrink film



Product view



Product view



Product and the sample of last shipment comparing



Product and the sample of last shipment comparing



Units bag size check



Units bag size check



Units bag weight check



Product size check



Product size check




Product size check



Product weight check

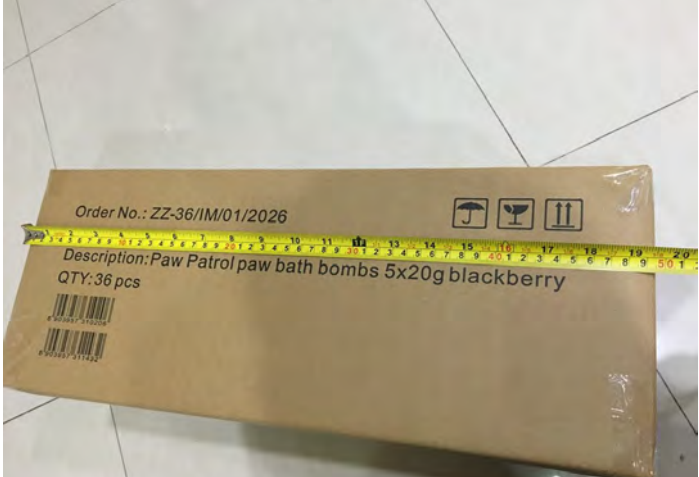

	
Outer carton gross weight check	Outer carton length check
	
Outer carton width check	Outer carton height check

3. ON-SITE TESTS & SPECIAL REQUIREMENTS

Result : Pending, see special test requirement 5.6,7,8

Test Requirements	Comments from Inspector (Actual finding/photo)	Result
Universal test requirements 1.Normal function check.(5 pcs per item) (Put the bath fizzer inside the 38-45°C water, and then the bath fizzer must be dissolved within 20 Minutes, then use a white cotton fabric to test if the color is easy to dye on the fabric .)		
		Pass



2.Bar code scanning test (S-3: <u>20</u> pcs))		Pass
3. 3M tape adhesive test (S-3 <u>0</u> pcs) (Use 3M tape to do this test)	N/A	N/A
4. Internal structure/Major Components check (1-3 pcs per item)	N/A	N/A



5. Carton dimension and weight check (3 ctns per item) (The tolerance should be within +/- 5% of the carton size and weight which printed on carton)	Actual pallet size and weight measurement as below: <table border="1"> <thead> <tr> <th>Item#</th><th>Printed on master carton/Spec</th><th>Actual measuring</th></tr> </thead> <tbody> <tr> <td>9250</td><td>49.5x26.2x20.2cm /4.66kgs</td><td>49.5x26.5x20.0cm /5.2kgs</td></tr> <tr> <td> </td><td> </td><td> </td></tr> </tbody> </table>	Item#	Printed on master carton/Spec	Actual measuring	9250	49.5x26.2x20.2cm /4.66kgs	49.5x26.5x20.0cm /5.2kgs				Pending, see remark 4
Item#	Printed on master carton/Spec	Actual measuring									
9250	49.5x26.2x20.2cm /4.66kgs	49.5x26.5x20.0cm /5.2kgs									
6. Carton drop test (1 ctn per item) (ISTA-1A, 1 corner, 3 edge and 6 face of master carton, height : ____cm) , no master carton and product damaged.	The factory refused to do carton drop test during inspection due to the PDQ packing	Pending									
Special test requirements (Depend on different product)											



7. Transportation test for outer carton (1-2 ctns per item) Use the factory’s transportation test machine to do this test for 1 hour, and then check if the product or package has any problem after test	The factory can not provide transportation test machine to do this test during inspection	Pending																								
8. Liquid bubble effect check (3 pcs per item) Mixing the shampoo with water, and then check the bubble effect	No any liquid bubble found after the bath bamb was completely dissolved.	Pending																								
9.Product weight check (5 pcs per item) The actual measured unit weight can not less than 165 g	Actual measured product weight as below (Unit:g): <table><tr><td>Item#</td><td>1</td><td>2</td><td>3</td><td>4</td><td>5</td></tr><tr><td>9250</td><td>22g</td><td>24g</td><td>25g</td><td>23g</td><td>23g</td></tr><tr><td></td><td></td><td></td><td></td><td></td><td></td></tr><tr><td></td><td></td><td></td><td></td><td></td><td></td></tr></table> 	Item#	1	2	3	4	5	9250	22g	24g	25g	23g	23g													Pass
Item#	1	2	3	4	5																					
9250	22g	24g	25g	23g	23g																					



10.Smell test (3 pcs per item)
Compare the scent liquid sample, and
check scent of each item)



Pass



11. Dyeing test (1 pcs per item) Immerse a cotton fabric into the water with dyed bath fizzer, and then wash the fabric in the clear water, then check if the color is stayed on the white fabric)	 	Pass
---	--	-------------

4. DEFECTIVES LIST				
Defect description	CRI	MAJ	MIN	Defective Picture
Item#9250(Paw patrol paw bath bombs 5x20g black berry)				
Damaged mark -撞伤	0	0	1	



Dirty mark -脏污	0	0	1	
Uneven blue color -蓝色不均匀	0	0	5	 





Item#9250(Paw patrol paw bath bombs 5x20g black berry)				
Sample size	Maximum Allowed	Total Defects	Result	Notes
CRI : 315	0	0	Pass	N/A
MAJ : 315	14	0	Pass	N/A
MIN : 315	21	7	Pass	N/A

End of the Report

Remark: If no found the relevant AQL for the item reference , pls refer the AQL of most proximate sample size. for example, no AQL for sample size 150 pcs, pls refer the AQL of most proximate sample size of 125 pcs. If the AQL failed, the overall inspection result should be rejected, and pls make a remark like "Rejected due to AQL failed for item XXXX" on the fist page of report.